

Work Order ID 138545

Monday, November 02, 2015 10:54:15 AM

138545

Shop Alone Page 1

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 11/2/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 11/13/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: *MF* Date: *15-11-02* Tooling: _____ Date: _____
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____
 Run Start ***NR1***
 Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D3391	I

100	Skidtubes	0.00							
100									
Skidtubes	Memo	0.02							

- 1-Cut tube to finish length as per Dwg D3391
- 2-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391
- 3-Open saddles and GHW holes to Ø0.4375" except for fwd saddle hole of detail "J"
- 4-Remove .030" from Fwd indexing Ridge as per Dwg D3391
- 5-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391
- 6-Deburr, scribe batch # on aft end.
- 7- Locate D3391-021 in D3391-023 at 9.00" (see view z-z)
- 8- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 using drill press.
- ON FIRST SIDE ONLY drill out fwd and forth fwd saddles holes to 0.500" per
- ON 2ND SIDE ONLYream out 2nd and forth hole to 0.499"
- D3391-021 R.A. H.

B-138545

NIA

15-11-2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																							
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																												
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																												
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																												
Large Fab ☐	Composite ☐	Supplier ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																								
Description Work Order Deviation				Disposition				Completed By																																																							
								Lead hand / Supervisor Approval Verification																																																							
										QC / QA Coordinator Approval																																																					
Root Cause		FAULT CATEGORY																																																													
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	No Re-verification ☐	Operator ☐	Offset/Setup ☐	Supplier ☐	Training ☐	Use for Testing ☐	Poor Information ☐	Rushing ☐	Product Improvement ☐	Process Improvement ☐	Manufacturing Process ☐	Past Due ☐	Pressure/Forced ☐	Bending ☐	Centre Not Concentric ☐	Cracks ☐	Crimp/Kink/Ripple/Wave ☐	Cuffs ☐	Crushing ☐	Heat Treat ☐	Wave/Twist in Tube ☐	Marks/Chatter ☐	Temperature/Cure ☐	Set-up ☐	BOM/Route ☐	Broken/Damage/Defect ☐	Inspection Incomplete/Unqualified ☐	Contamination ☐	Countersink ☐	Cut Too Short ☐	Instructions Incomplete/Unclear ☐	Drill Holes ☐	Power Loss/Surge ☐	Folio/Program ☐	Grain ☐	Weld ☐	Wrong Stock Pulled ☐	Out of Sequence ☐	Off-set ☐	Mislabeled ☐	Fit/Function ☐	Misaligned/off center ☐	Positioned Wrong ☐	Outside Dimensions ☐	Over/Under tolerance ☐	Part Incorrect ☐	Part Lost/Missing ☐	Part Moved ☐	Drawing ☐	Finish ☐	Misread ☐	Turning Sequence ☐
OTHER :																																																															

Work Order ID 138545

138545

Page 2

Monday, November 02, 2015 10:54:15 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 11/2/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 11/13/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	9- Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker, ***DO NOT DRILL HOLES #3-19-20 FROM FWD END OF JIG*** Locating from two fwd wearplate holes in D3391-023 drill remaining 6 wearplate holes in D3391-021 using DT8937								
	10- Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (10 holes) as per Dwg D3391 Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391 Deburr and blow out all chips from inside tube, scribe batch # in D3391-023 at aft end.								
	11- Open 10 wearplate holes in D3391-021 to 0.297" dia. N/A								
	12- DEBURR AND BLOW OUT CHIPS								

110

110

QC

Quality Control

QC5- Inspect part completeness to step on W/O 0.00

Memo

0.00

DAS
38

NOV 03 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 138545

138545

Page 3

Monday, November 02, 2015 10:54:15 AM

Item ID: D3391-023 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Mid Tube Assembly
 Start Date: 11/2/2015 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 11/13/2015 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Chemical Conversion Coat per QSI005 4.1	0.00							
120									
HandFinish	Memo	0.00							
Hand Finishing									
130	QC7-Inspect Chemical Conversion Coat	0.00							
130									
QC	Memo	0.00							
Quality Control									

DAS
03
9-88

12/11/13
 15-11-3

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
									QC / QA Coordinator Approval																
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER :																			

Work Order ID 138545

138545

Page 4

Monday, November 02, 2015 10:54:15 AM

Item ID: D3391-023 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Mid Tube Assembly
 Start Date: 11/2/2015 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 11/13/2015 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	Skidtubes	0.00							
140									
Skidtubes	Memo	0.01							
Skidtubes	1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: 11-2-12 batch#: 133427 NOTE:ENSURE WEB IS INSERTED IN AFT END OF TUBE								
150	QC5- Inspect part completeness to step on W/O	0.00							
150									
QC	Memo	0.00							
Quality Control									

15-11-3

DAS
18
9-09

1 0 15-11-04

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :							
Misidentified	☐	Past Due	☐								

Work Order ID 138545

138545

Page 5

Monday, November 02, 2015 10:54:15 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 11/2/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 11/13/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160	Skidtubes	0.00				1	0	8615-1109	
160									
Skidtubes	Memo	0.01							
Skidtubes	1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush								
170	QC10- Inspect visual per QSI004- ground welds	0.00				1			
170									
QC	Memo	0.00							
Quality Control									DAS 38 9-89 NOV 04 2015
180	QC5- Inspect part completeness to step on W/O	0.00				1			
180									
QC	Memo	0.00							
Quality Control									DAS 38 9-89 NOV 04 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY																																																																																																																											
Environment	☐	Design	☐	Doc/Data	☐	Equip/Tooling	☐	Handling/Pre	☐	Material	☐	Internal Transport	☐	Tribal Knowledge	☐	LOA	☐	Substation	☐	Past Expiry Date	☐	Misidentified	☐	No Re-verification	☐	Operator	☐	Offset/Setup	☐	Supplier	☐	Training	☐	Use for Testing	☐	Poor Information	☐	Rushing	☐	Product Improvement	☐	Process Improvement	☐	Manufacturing Process	☐	Past Due	☐	Pressure/Forced	☐	Bending	☐	Centre Not Concentric	☐	Cracks	☐	Crimp/Kink/Ripple/Wave	☐	Cuffs	☐	Crushing	☐	Heat Treat	☐	Wave/Twist in Tube	☐	Marks/Chatter	☐	Temperature/Cure	☐	Set-up	☐	BOM/Route	☐	Broken/Damage/Defect	☐	Inspection Incomplete/Unqualified	☐	Contamination	☐	Countersink	☐	Cut Too Short	☐	Instructions Incomplete/Unclear	☐	Drill Holes	☐	Power Loss/Surge	☐	Folio/Program	☐	Grain	☐	Weld	☐	Wrong Stock Pulled	☐	Out of Sequence	☐	Off-set	☐	Mislabeled	☐	Fit/Function	☐	Misaligned/off center	☐	Positioned Wrong	☐	Outside Dimensions	☐	Over/Under tolerance	☐	Part Incorrect	☐	Part Lost/Missing	☐	Part Moved	☐	Drawing	☐	Finish	☐	Misread	☐	Turning Sequence	☐
OTHER : ☐																																																																																																																															

Work Order ID 138545

138545

Page 6

Monday, November 02, 2015 10:54:15 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 11/2/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 11/13/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
185	Pressure Wash per QSI005 4.3	0.00							
185									
HandFinish	Memo	0.01							
Hand Finishing	AND REALODINE AS PER PAR09-043								
190	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
190	<i>M 133454</i>								
Powdercoat	Memo	0.00							
Powder Coating	START TIME: <i>7:45</i> OVEN TEMPERATURE: <i>320</i> FINISH TIME: <i>8:15</i>								
200	QC3- Inspect Part Finish	0.00							
200									
QC	Memo	0.00							
Quality Control									

1 x of all is 11/02

1 of 15-11-5 **DAS 34 9-89**

1 x of all is 11/05 **DAS 15 9-89**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	☐	No Re-verification ☐		☐	Pressure/Forced	☐	Temperature/Cure
Design ☐	☐	Operator ☐		☐	Bending	☐	Set-up
Doc/Data ☐	☐	Offset/Setup ☐		☐	Centre Not Concentric	☐	BOM/Route
Equip/Tooling ☐	☐	Supplier ☐		☐	Cracks	☐	Broken/Damage/Defect
Handling/Pre ☐	☐	Training ☐		☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified
Material ☐	☐	Use for Testing ☐		☐	Cuffs	☐	Contamination
Internal Transport ☐	☐	Poor Information ☐		☐	Crushing	☐	Countersink
Tribal Knowledge ☐	☐	Rushing ☐		☐	Heat Treat	☐	Cut Too Short
LOA ☐	☐	Product Improvement ☐		☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear
Substation ☐	☐	Process Improvement ☐		☐	Marks/Chatter	☐	Drill Holes
Past Expiry Date ☐	☐	Manufacturing Process ☐		OTHER : _____			
Misidentified ☐	☐	Past Due ☐					

Work Order ID 138545

138545

Page 7

Monday, November 02, 2015 10:54:15 AM

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Mid Tube Assembly
Start Date: 11/2/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/13/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230		0.00							
230	HandFinishing								
HandFinish	Memo	0.01							
Hand Finishing	1-Install Inserts as per Dwg								
240		0.00							
240	QC5- Inspect part completeness to step on W/O								
QC	Memo	0.00							
Quality Control									
250		0.00							
250	Identify as per dwg & Stock Location: <i>add</i>								
Packaging	Memo	0.01							
Packaging									

DAS
38
9-89

NOV 05 2015

DAS
28
9-89

NOV 06 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval				
Description Work Order Deviation				Disposition							
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter		☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes		☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center		☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence	
				OTHER :							

Work Order ID 138545

138545

Page 8

Monday, November 02, 2015 10:54:15 AM

Item ID: D3391-023

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Mid Tube Assembly

Start Date: 11/2/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/13/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

260

QC21 - Final Inspection - Work Order Release

0.00

260

QC

Memo

0.00

Quality Control

MC NOV 06 2015

MC NOV 06 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval				
Description Work Order Deviation				Disposition							
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter		☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes		☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center		☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence	
				OTHER :							

Picklist Print

Monday, November 02, 2015 10:54:15 AM

Page 1

Work Order ID: 138545

138545

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 11/2/2015

Required Date: 11/13/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.10.20New Issue KJ/EC
 IPP B06.02.10ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-100

Manufactured No

100

Each

110.0000

1

1

D2500-1-100

Skidtube Extrusion

**

Location

Loc Qty

Loc Code

HALL

110

133815

92

86065

18

D3389-1

Manufactured No

140

Each

7.0000

1

1

D3389-1

Web

**

Location

Loc Qty

Loc Code

LG002

7

134325

2

134887

5

138161

①

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube ☐</td> <td style="width:15%;">Cross tube ☐</td> <td style="width:15%;">Water Jet ☐</td> <td style="width:15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																															
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																				
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																				
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																				
Large Fab ☐	Composite ☐	Supplier ☐																																																																					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																
Description Work Order Deviation				Disposition				Completed By																																																															
								Lead hand / Supervisor Approval Verification																																																															
										QC / QA Coordinator Approval																																																													
Root Cause <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Environment ☐</td> <td style="width:15%;">No Re-verification ☐</td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Pressure/Forced ☐</td> <td style="width:15%;">Temperature/Cure ☐</td> <td style="width:15%;">Power Loss/Surge ☐</td> <td style="width:15%;">Positioned Wrong ☐</td> </tr> <tr> <td>Bending ☐</td> <td>Set-up ☐</td> <td>Folio/Program ☐</td> <td>Outside Dimensions ☐</td> </tr> <tr> <td>Centre Not Concentric ☐</td> <td>BOM/Route ☐</td> <td>Grain ☐</td> <td>Over/Under tolerance ☐</td> </tr> <tr> <td>Cracks ☐</td> <td>Broken/Damage/Defect ☐</td> <td>Weld ☐</td> <td>Part Incorrect ☐</td> </tr> <tr> <td>Crimp/Kink/Ripple/Wave ☐</td> <td>Inspection Incomplete/Unqualified ☐</td> <td>Wrong Stock Pulled ☐</td> <td>Part Lost/Missing ☐</td> </tr> <tr> <td>Cuffs ☐</td> <td>Contamination ☐</td> <td>Out of Sequence ☐</td> <td>Part Moved ☐</td> </tr> <tr> <td>Crushing ☐</td> <td>Countersink ☐</td> <td>Off-set ☐</td> <td>Drawing ☐</td> </tr> <tr> <td>Heat Treat ☐</td> <td>Cut Too Short ☐</td> <td>Mislabeled ☐</td> <td>Finish ☐</td> </tr> <tr> <td>Wave/Twist in Tube ☐</td> <td>Instructions Incomplete/Unclear ☐</td> <td>Fit/Function ☐</td> <td>Misread ☐</td> </tr> <tr> <td>Marks/Chatter ☐</td> <td>Drill Holes ☐</td> <td>Misaligned/off center ☐</td> <td>Turning Sequence ☐</td> </tr> </table>						Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																						
Design ☐	Operator ☐																																																																						
Doc/Data ☐	Offset/Setup ☐																																																																						
Equip/Tooling ☐	Supplier ☐																																																																						
Handling/Pre ☐	Training ☐																																																																						
Material ☐	Use for Testing ☐																																																																						
Internal Transport ☐	Poor Information ☐																																																																						
Tribal Knowledge ☐	Rushing ☐																																																																						
LOA ☐	Product Improvement ☐																																																																						
Substation ☐	Process Improvement ☐																																																																						
Past Expiry Date ☐	Manufacturing Process ☐																																																																						
Misidentified ☐	Past Due ☐																																																																						
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																				
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																				
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																				
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																				
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																				
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																				
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																				
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																				
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																				
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																				
		OTHER : ☐																																																																					

Picklist Print

Monday, November 02, 2015 10:54:15 AM

Work Order ID: 138545

138545

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 11/2/2015

Required Date: 11/13/2015

Start Qty: 1.00

Required Qty: 1.00

D3681-1

Manufactured No

160

Each

48.0000

5

5

D3681-1

Spacer

**

BE15-11-04

Location

Loc Qty

Loc Code

LG001

48

132711

1

133987

11

137757

36

5

ALS4-1032-130

AELS4-1032-130 Purchased

No

230

Each

3,316.000

20

20

AI S4-1032-130

Rivnut

**

15/11/05

Location

Loc Qty

Loc Code

CCK004

3316

M133077

3316

820

X

1x D4095-045 / B131460 wcr plate center.

12x AN3C-4A / M133446 bolts.

12x NAS1149CO 332R / M133281 washers.

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐				FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐							

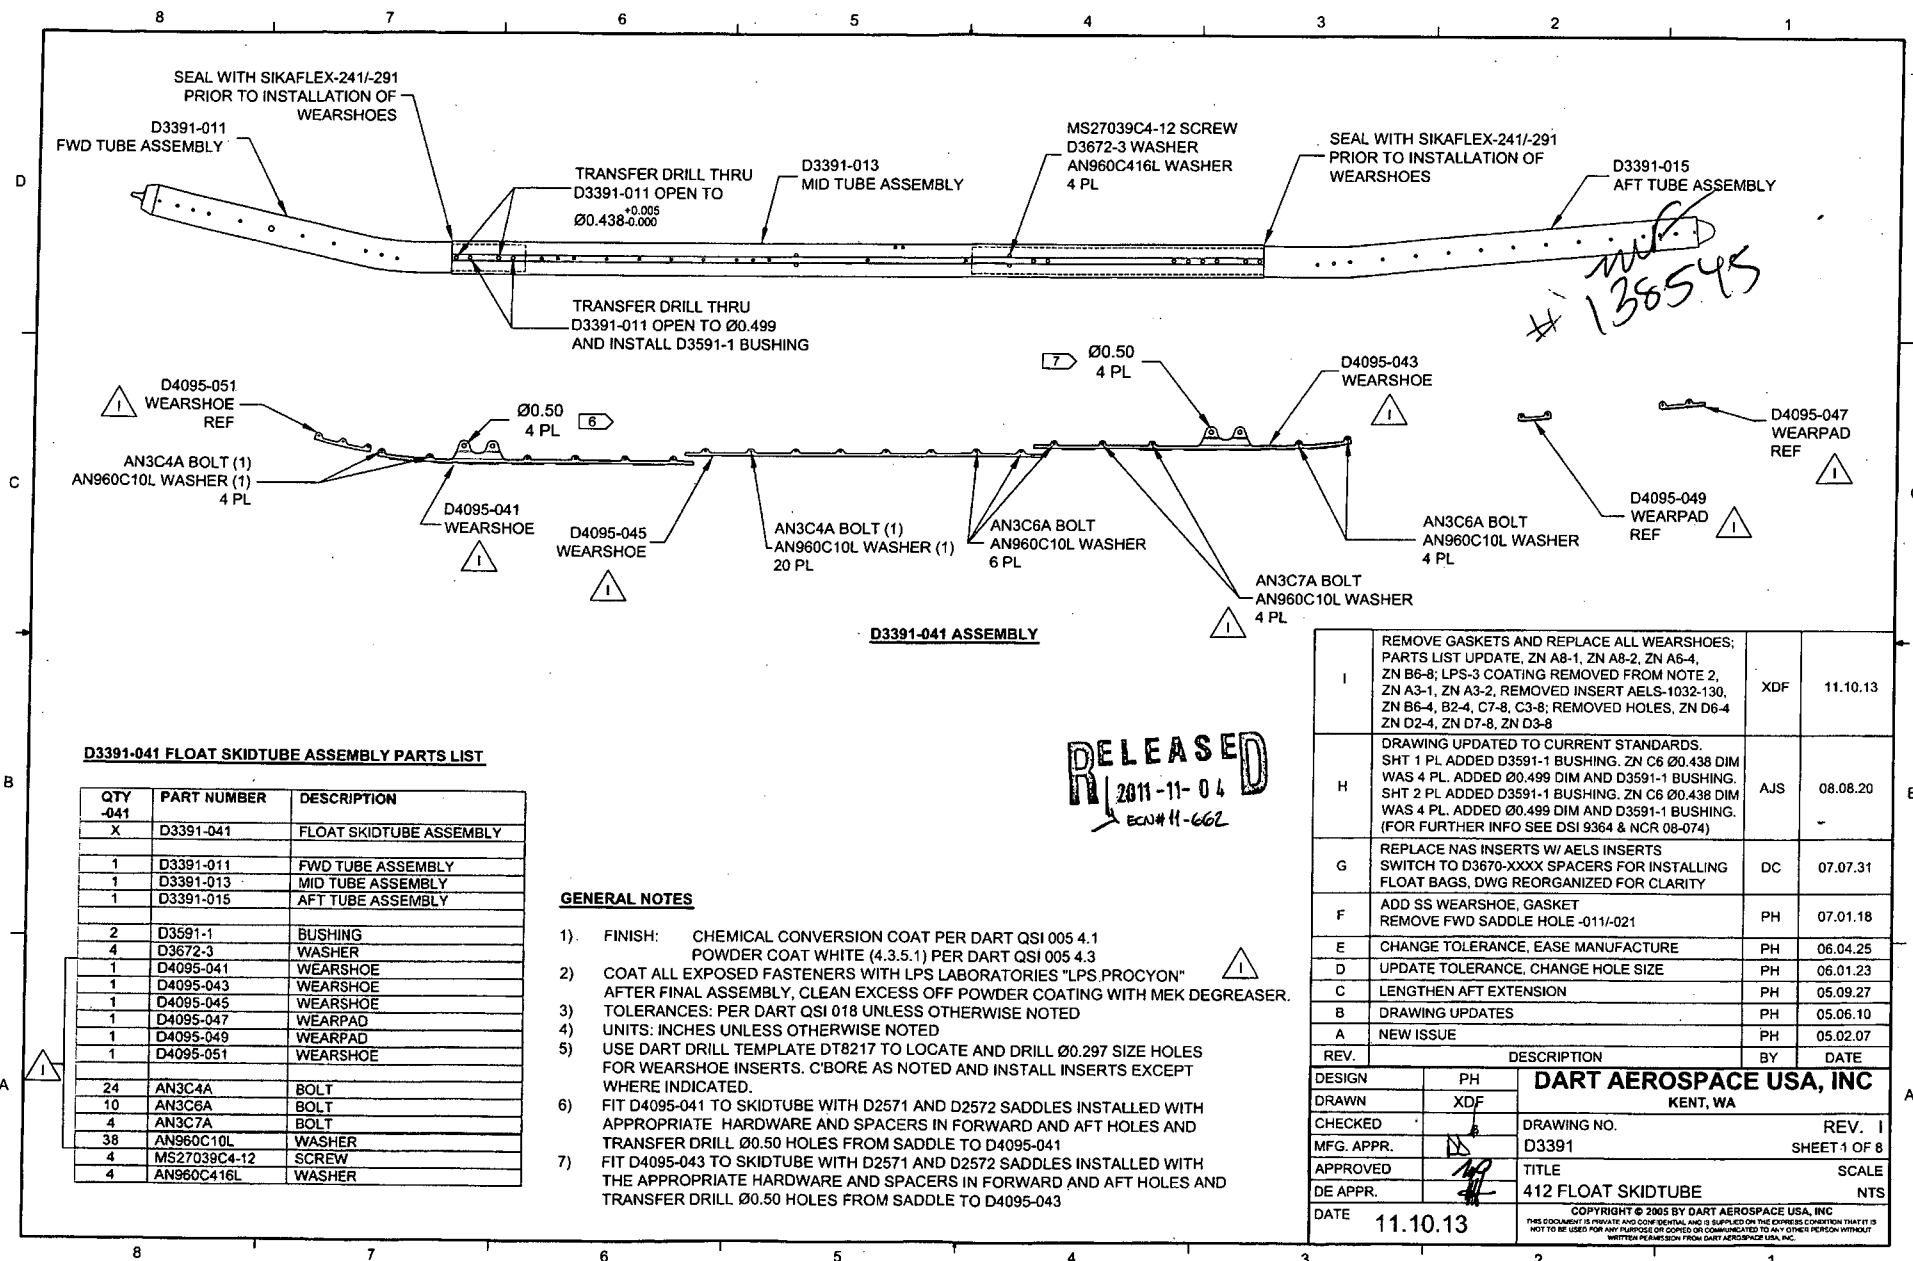

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -041	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1). FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2). COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3). TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4). UNITS: INCHES UNLESS OTHERWISE NOTED
- 5). USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.
- 6). FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7). FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A8-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL. ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL. ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC KENT, WA	
DRAWN	XDF		
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

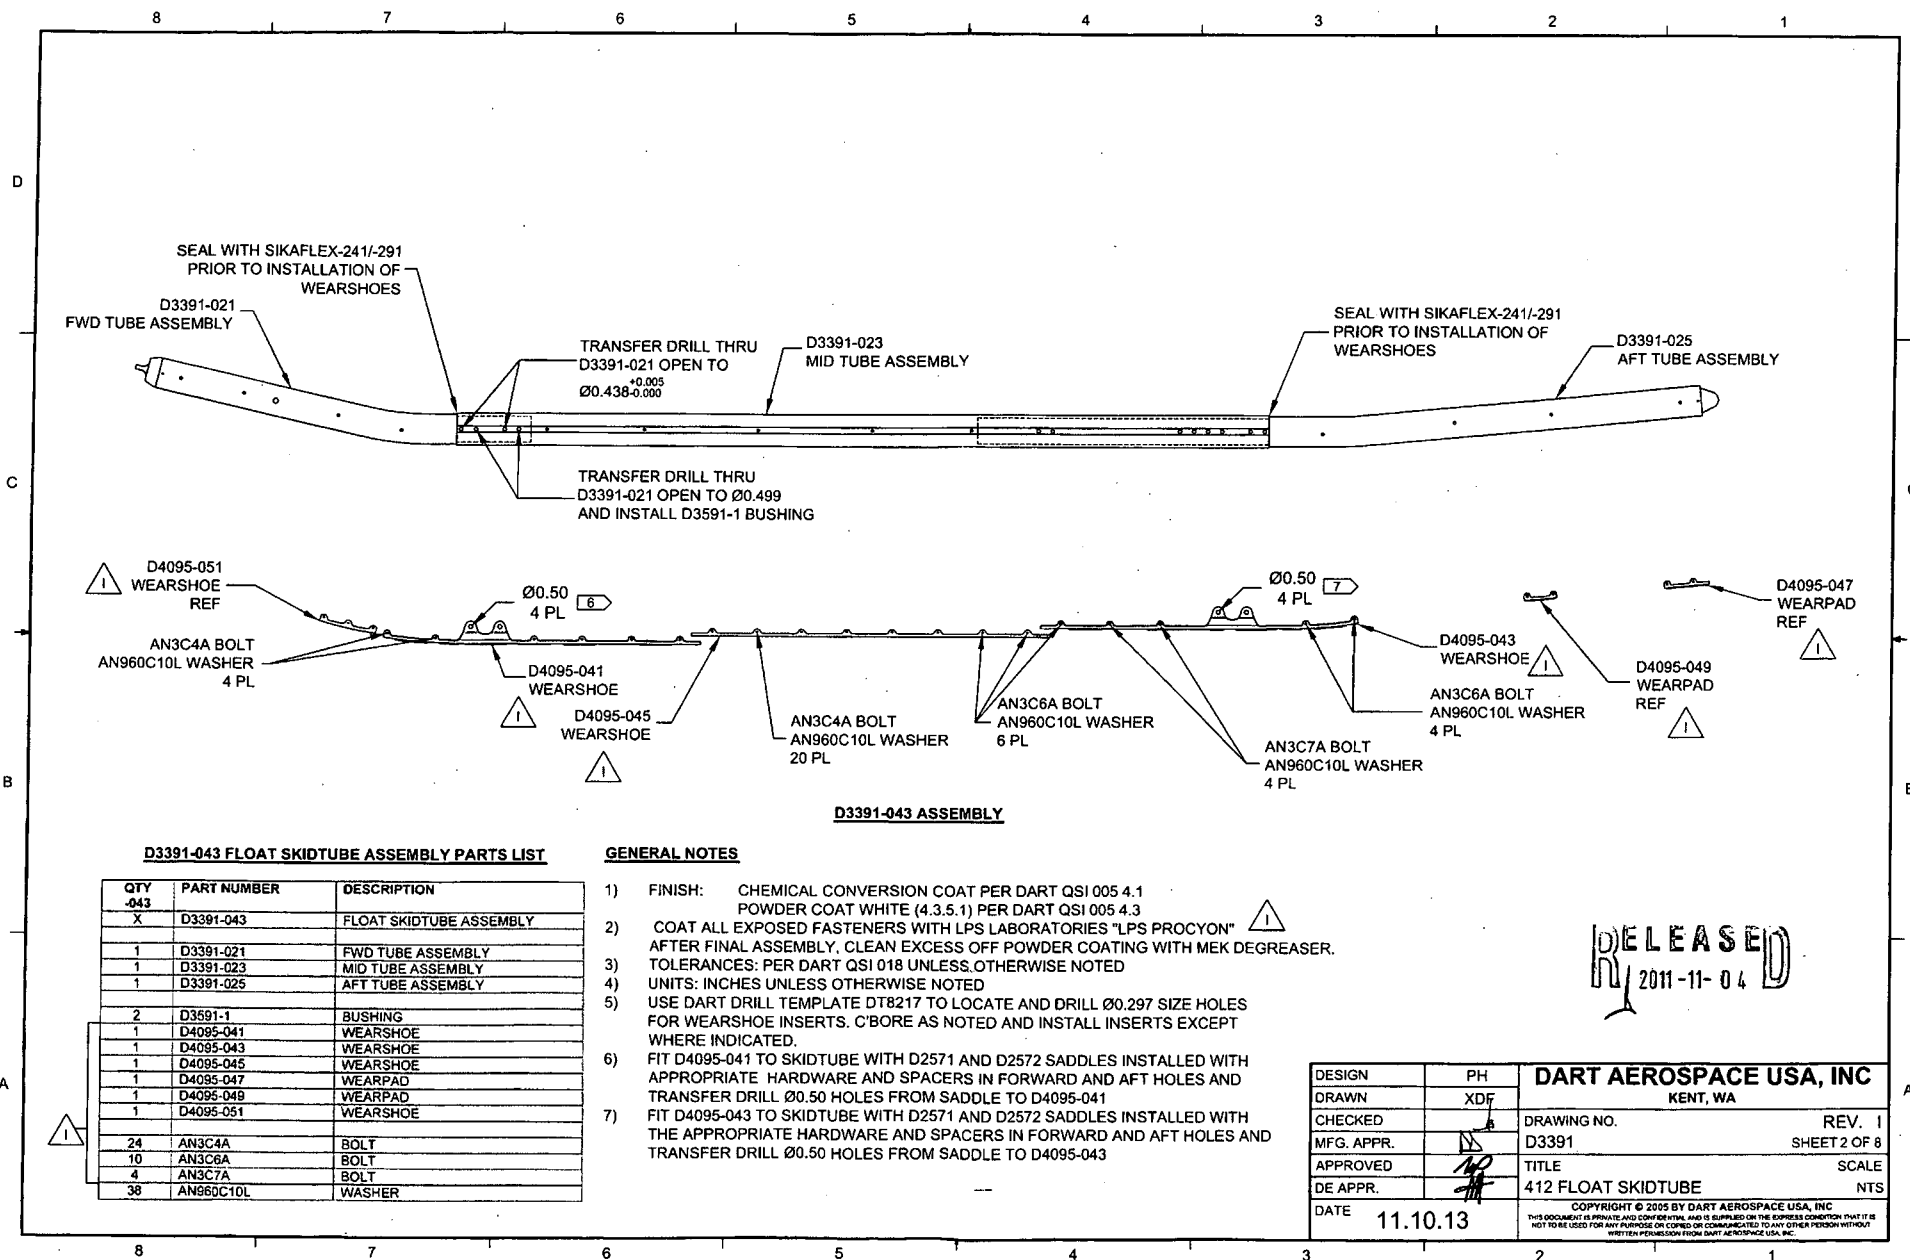

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : ☐					


8 7 6 5 4 3 2 1

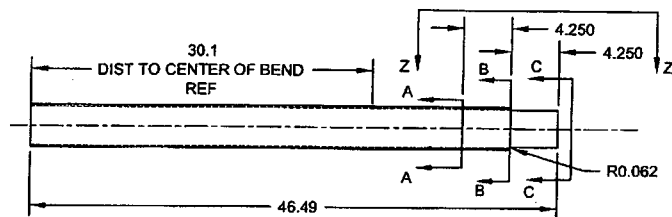


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

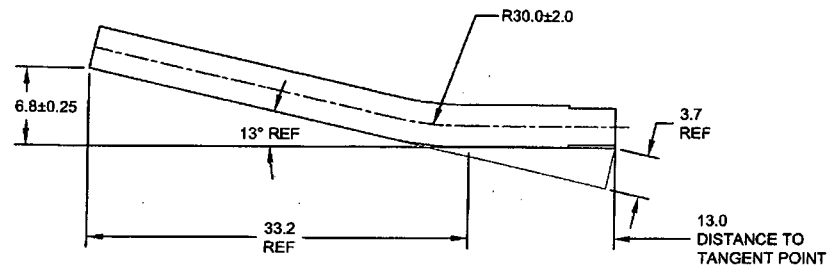


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

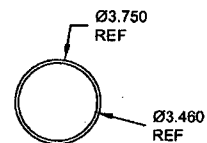


SECTION A-A
SCALE 2X

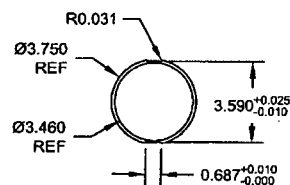

SECTION B-B
SCALE 2X

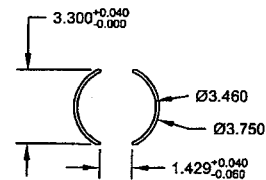

SECTION C-C
SCALE 2X

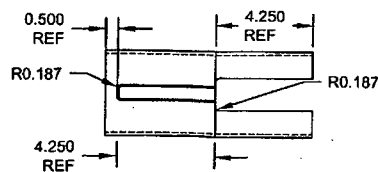

VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE LOANED, REPRODUCED OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval				
Description Work Order Deviation				Disposition							
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter		☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes		☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center		☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence	
				OTHER :							

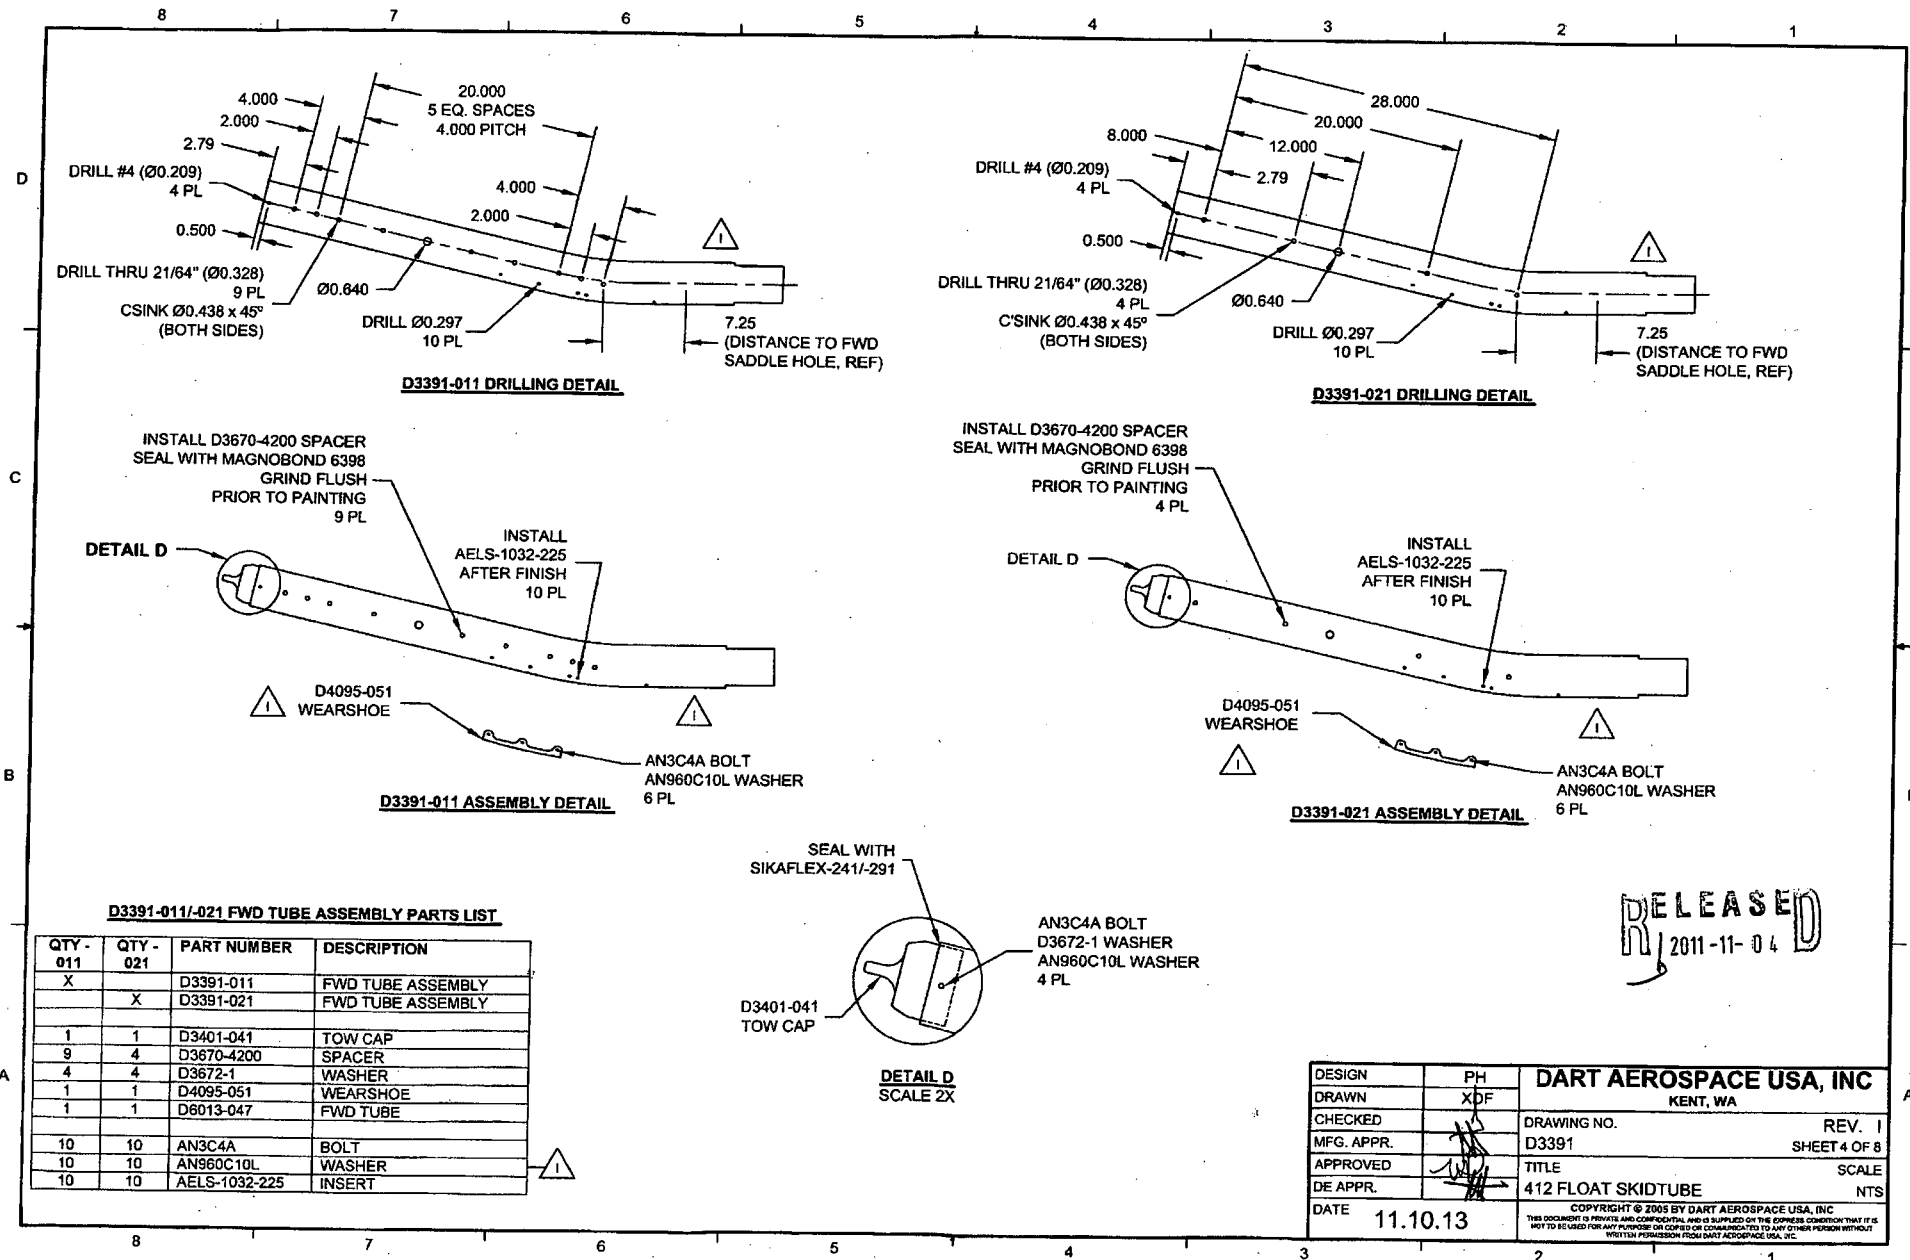

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐



Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :							
Misidentified	☐	Past Due	☐								


8 7 6 5 4 3 2 1

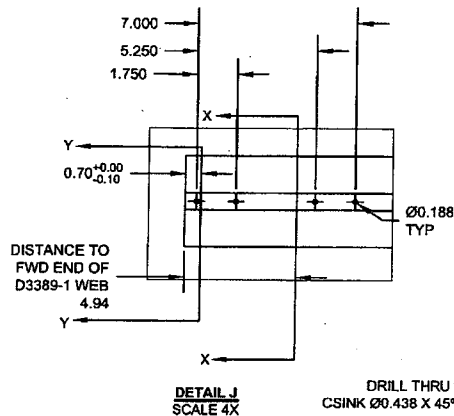

DRILL THRU 21/64" (Ø0.328)
CSINK Ø0.438 X 45° (BOTH SIDES)
12 PL

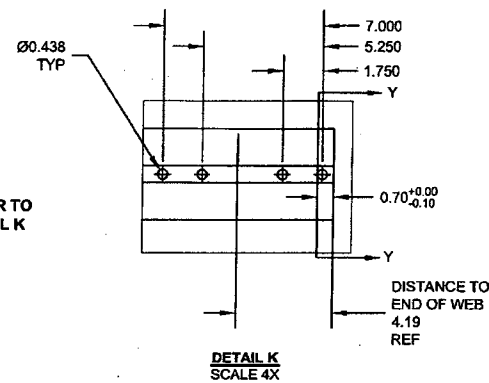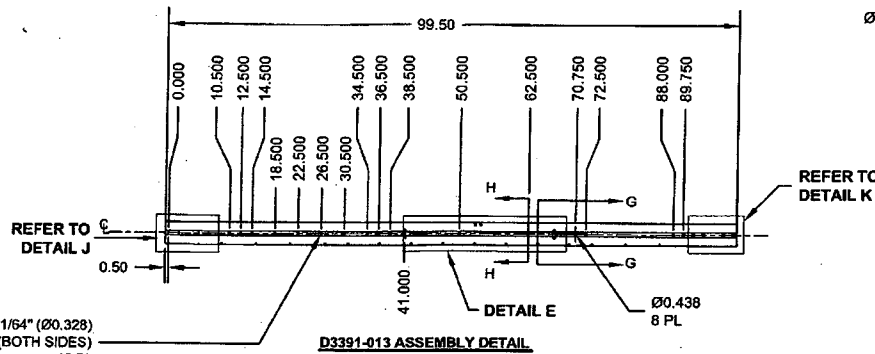


INSTALL
D3681-1 SPACER

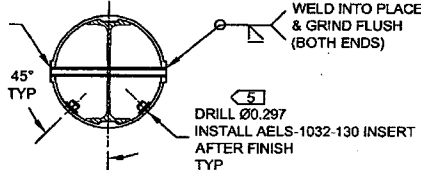


WELD INTO PLACE
& GRIND FLUSH
(BOTH ENDS)


DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
AFTER FINISH
TYP

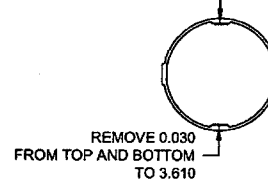

REMOVE 0.225
FROM TOP AND BOTTOM
TO 3.800
(0.7 FROM BOTH ENDS)

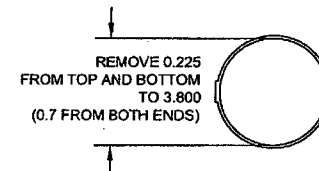


DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
4 PL

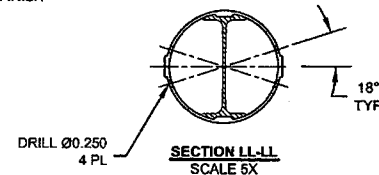


D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

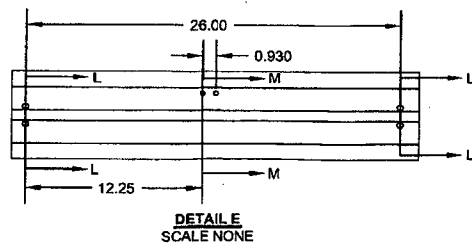

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
4 PL

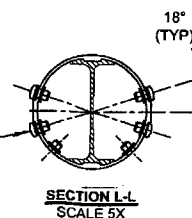

D3391-013 MID TUBE ASSEMBLY

- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- WELDING: PER DART QSI 004

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMERCIALIZED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

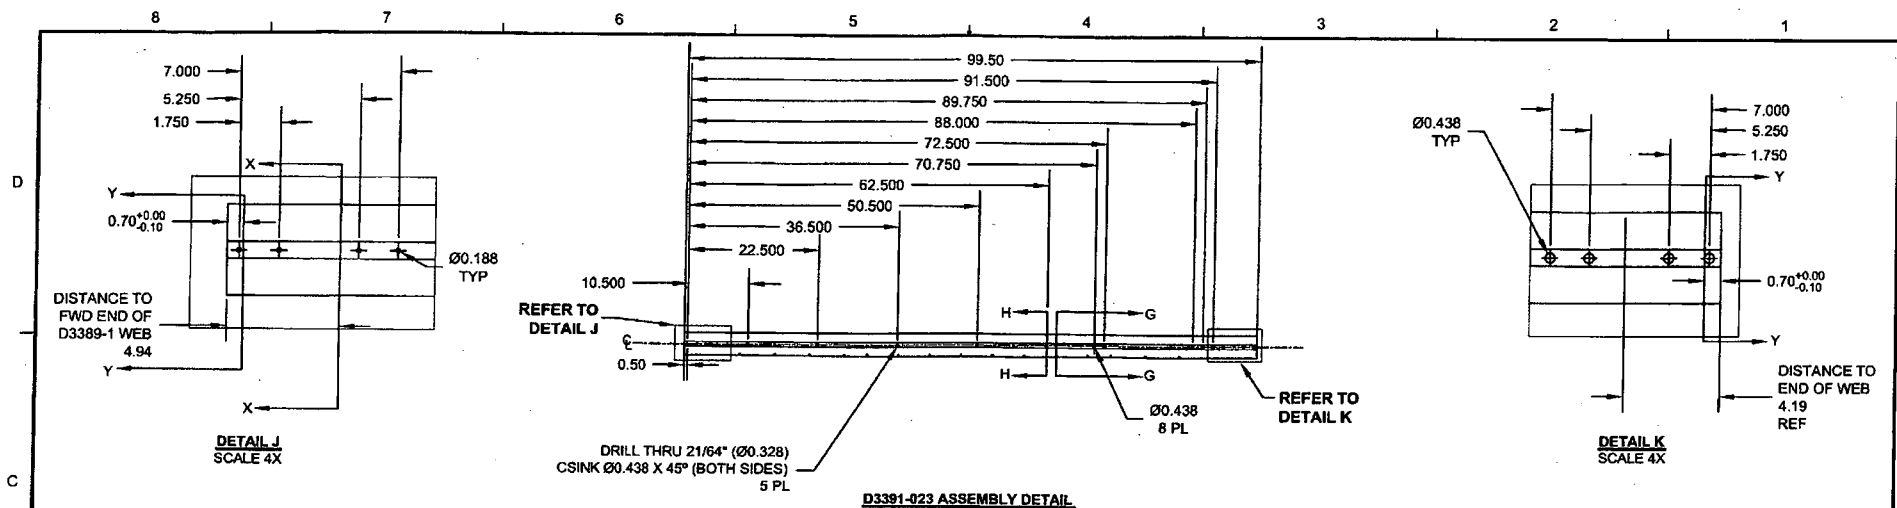


SECTION G-G
SCALE 5X

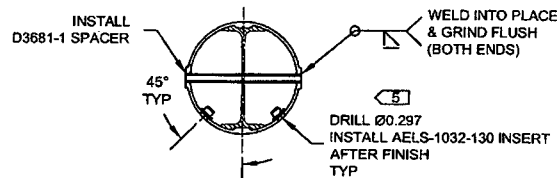

SECTION H-H
SCALE 5X

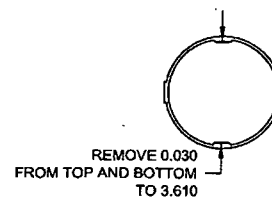

SECTION X-X
SCALE 5X

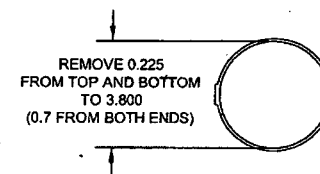

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY -	PART NUMBER	DESCRIPTION
023		
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____			
Misidentified	☐	Past Due	☐				

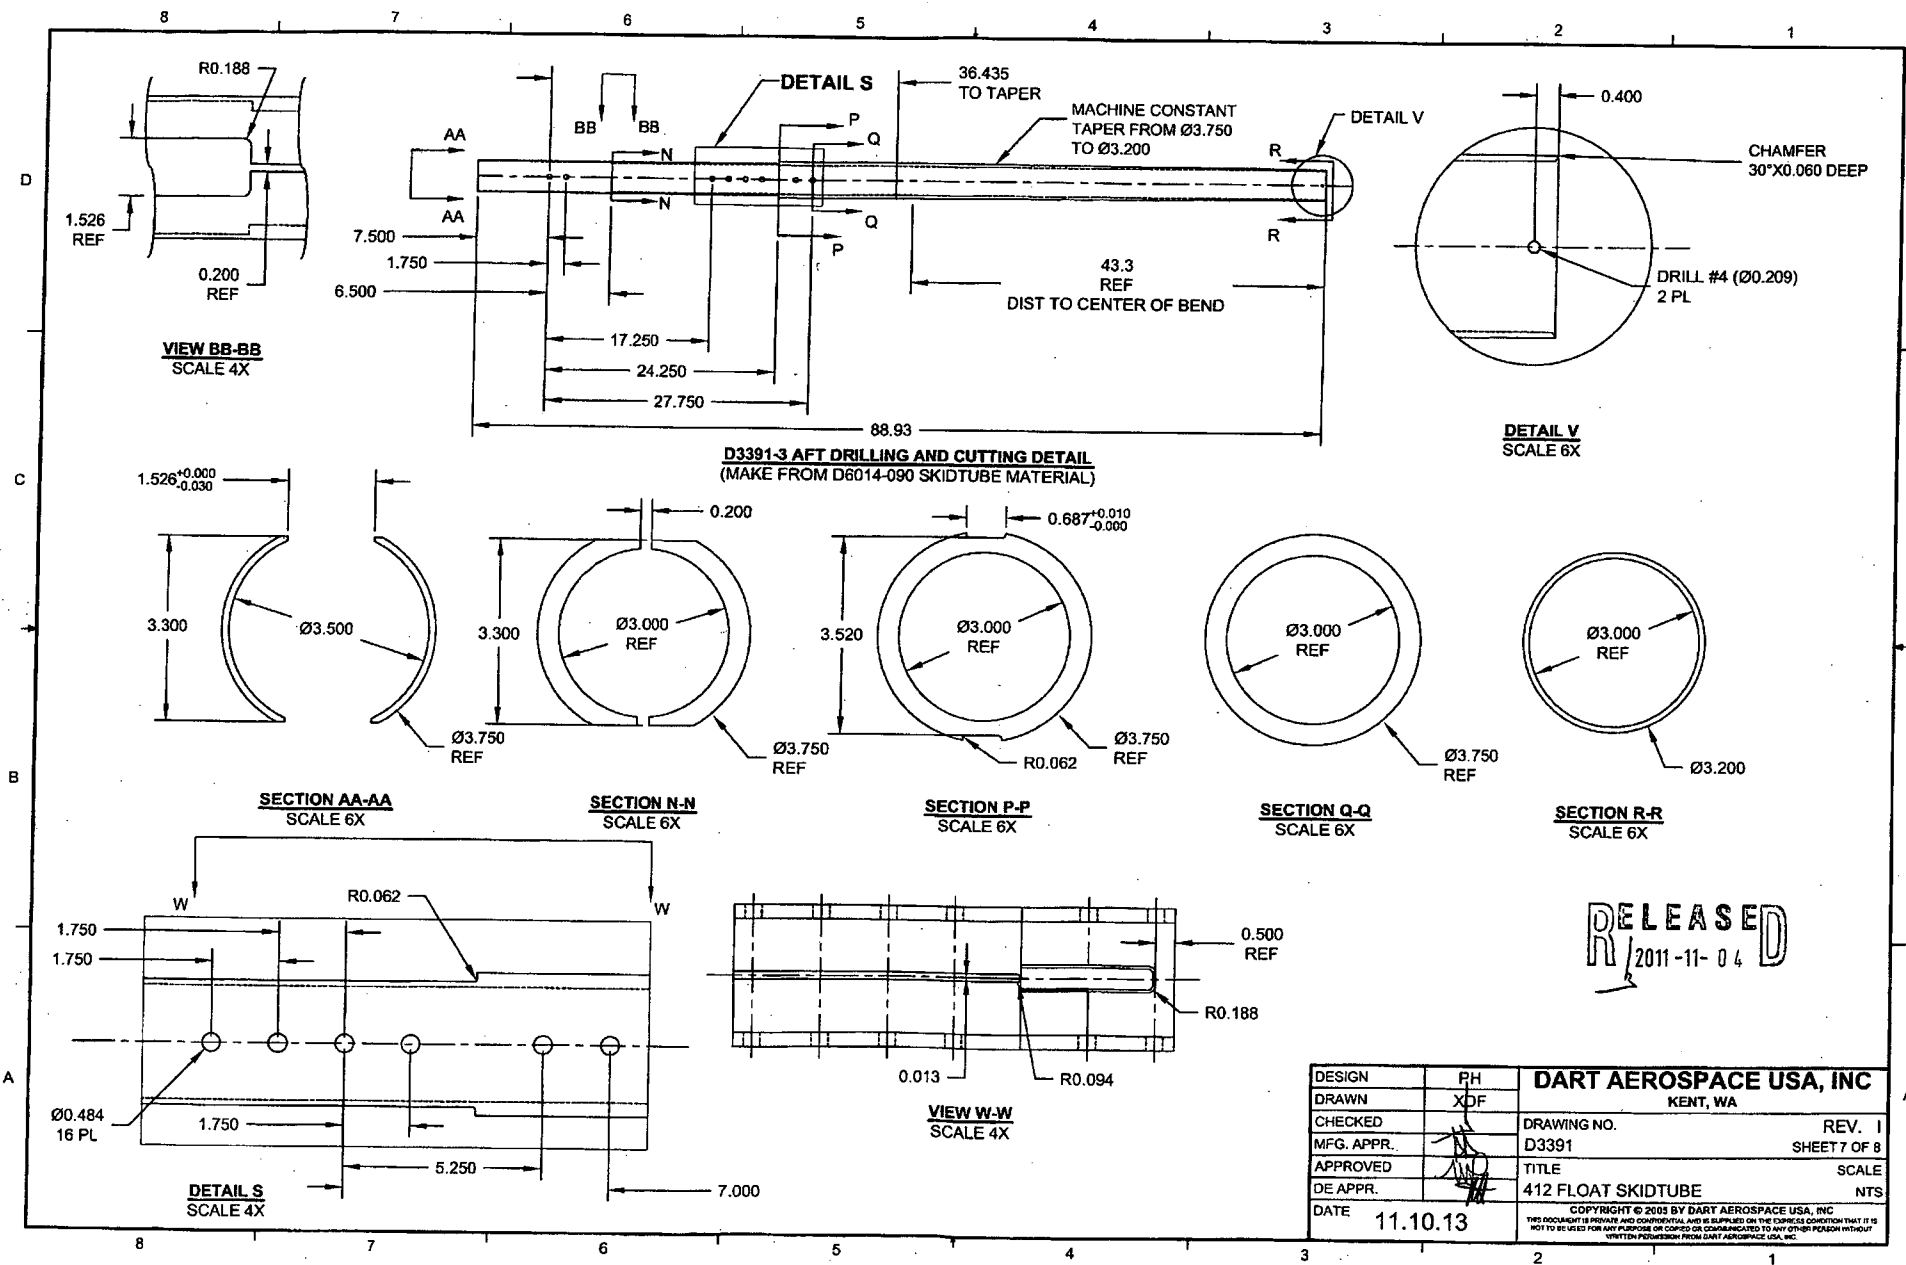

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
Environment ☐	Design ☐	Doc/Data ☐	Equip/Tooling ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Handling/Pre ☐	Material ☐	Internal Transport ☐	Tribal Knowledge ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
LOA ☐	Substation ☐	Past Expiry Date ☐	Misidentified ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
				Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
				Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
				Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
				Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
				Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
				Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
				Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐				OTHER : ☐			

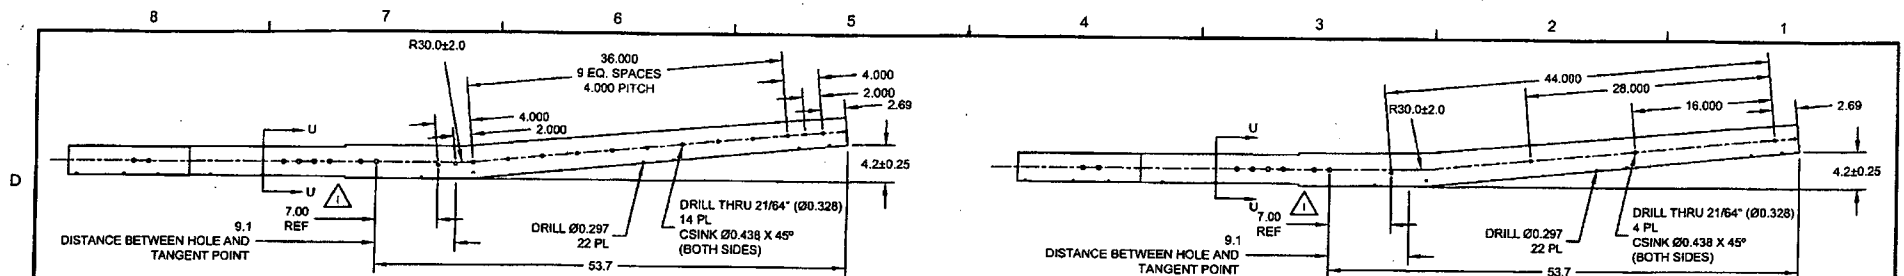


D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

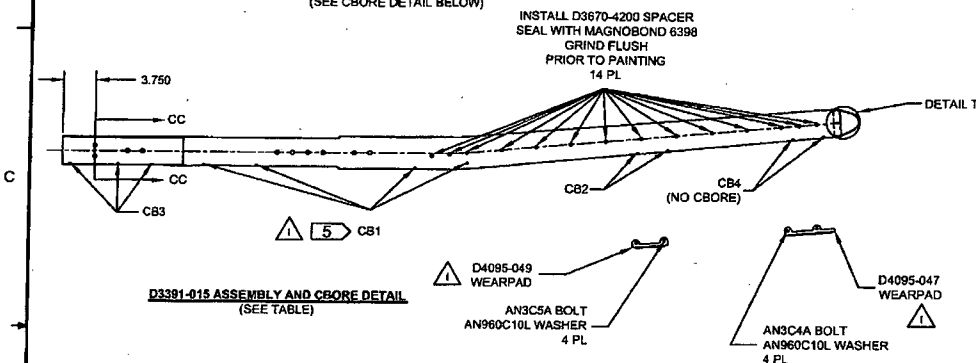


D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

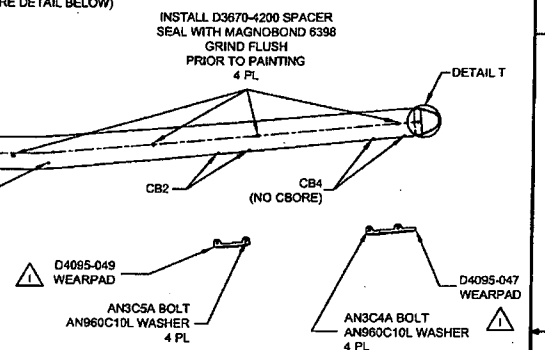


D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-090	AFT TUBE
14	14	AELS-1032-130	INSERT
8	8	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

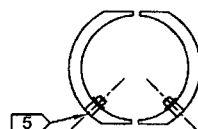


SECTION U-U
SCALE 3X

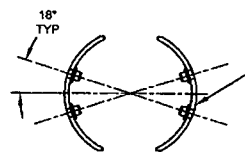

SECTION CC-CC
SCALE 3X

DRILL 0.391
CBORE 0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT
4 PL

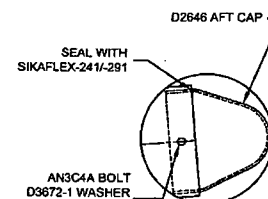

DETAIL T
SCALE 4X

RELEASED
2011-11-04

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	0.430 X 0.170	AELS-1032-225
CB2	4	4	0.430 X 0.170	AELS-1032-130
CB3	6	6	0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____			
Description Work Order Deviation				Disposition							
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter		☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes		☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center		☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence	
				OTHER :							